

**Level and Crack Monitoring**

**Our Ref: 552624**

**Date of Issue: 10/10/2019**

**Provider Details**

**CET Property Services - 0116 2605309**

**Monitoring Details**

<b>Instruction Date:</b>	<b>15/10/2018</b>		
<b>Number of visits</b>	<b>7</b>	<b>Visit Frequency (Wks)</b>	<b>8</b>

**Visit Dates (future dates are estimated)**

<b>Setup</b>	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>	<b>6</b>
<b>22/11/18</b>	<b>17/01/19</b>	<b>14/03/19</b>	<b>09/05/19</b>	<b>04/07/19</b>	<b>29/08/19</b>	<b>24/10/19</b>

**Client Details**

Insurance Co.:	<b>AXA</b>
Client Ref:	<b>6873723</b>
Client Name:	<b>Sedgwick</b>
Technical Mgr:	
Customer support	
Tel:	
Email:	


**Risk Address**

Occupier:	<b>Removed for data protection purposes</b>
Address:	<b>10 Hook Lane</b>
Address:	
Town:	<b>Potters Bar</b>
County:	
Post Code:	<b>EN6 4DA</b>
Contact Name	<b>Removed for data protection purposes</b>

**Level and Crack Monitoring - Site Sketch**

Our Ref: 552624

Date of Issue: 10/10/2019

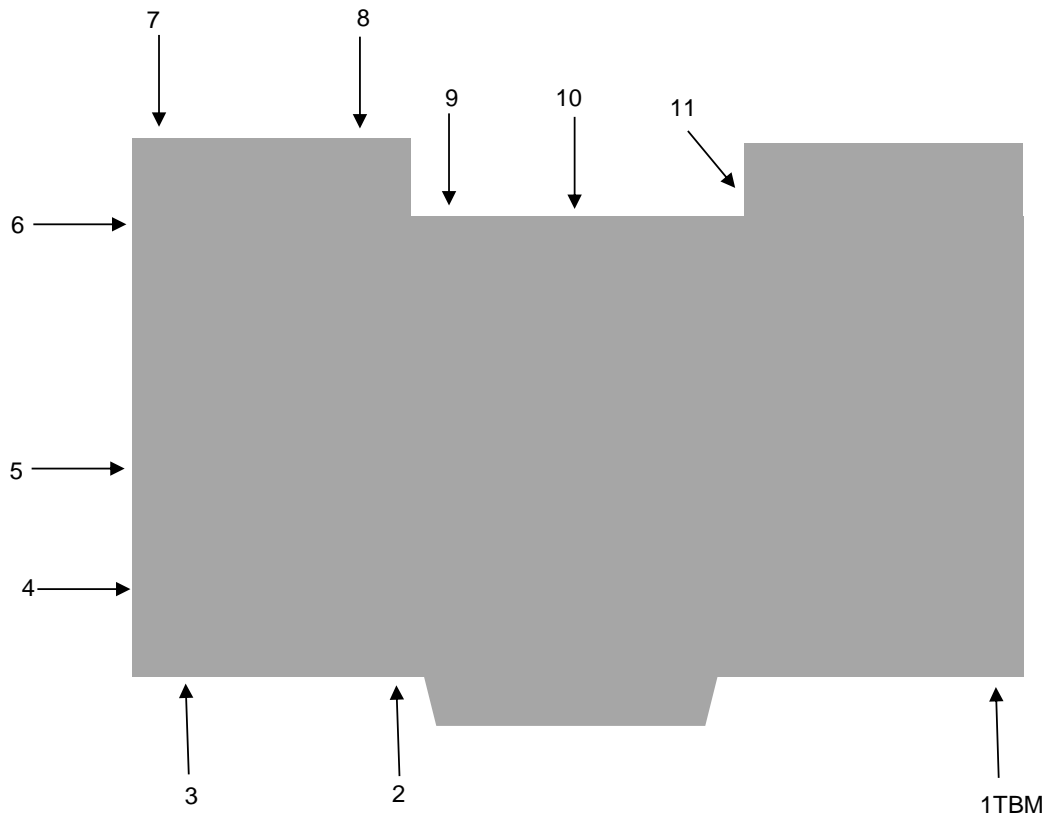

**Level Monitoring - Reduced Levels (in metres)**

Our Ref:

552624


Date of Issue:

10/10/19

Reading Date	22/11/18	6/2/19	25/4/19	20/6/19	20/8/19	10/10/19						
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.8355	10.8355	10.8355	10.8355	10.8355	10.8355						
2	10.9020	10.9015	10.9023	10.9022	10.9021	10.9015						
3	10.8805	10.8817	10.8839	10.8836	10.8819	10.8770						
4	10.9270	10.9284	10.9300	10.9298	10.9270	10.9233						
5	10.9993	11.0008	11.0019	11.0014	10.9985	10.9945						
6	10.9977	10.9995	11.0013	11.0006	10.9958	10.9898						
7	11.0159	11.0172	11.0184	11.0182	11.0134	11.0070						
8	11.0263	11.0264	11.0267	11.0266	11.0242	11.0232						
9	11.0608	11.0611	11.0609	11.0602	11.0594	11.0592						
10	11.1132	11.1131	11.1131	11.1128	11.1118	11.1112						
11	11.1268	11.1263	11.1263	11.1255	11.1256	11.1242						
not used												
not used												
not used												
not used												
not used												
Tech Initials	AH	AH	AH	JY/JH	JL	RB						
Level S/N.	520038	520038	520038	522936	522937	522939						



Level Monitoring - Movement relative to datum against Date

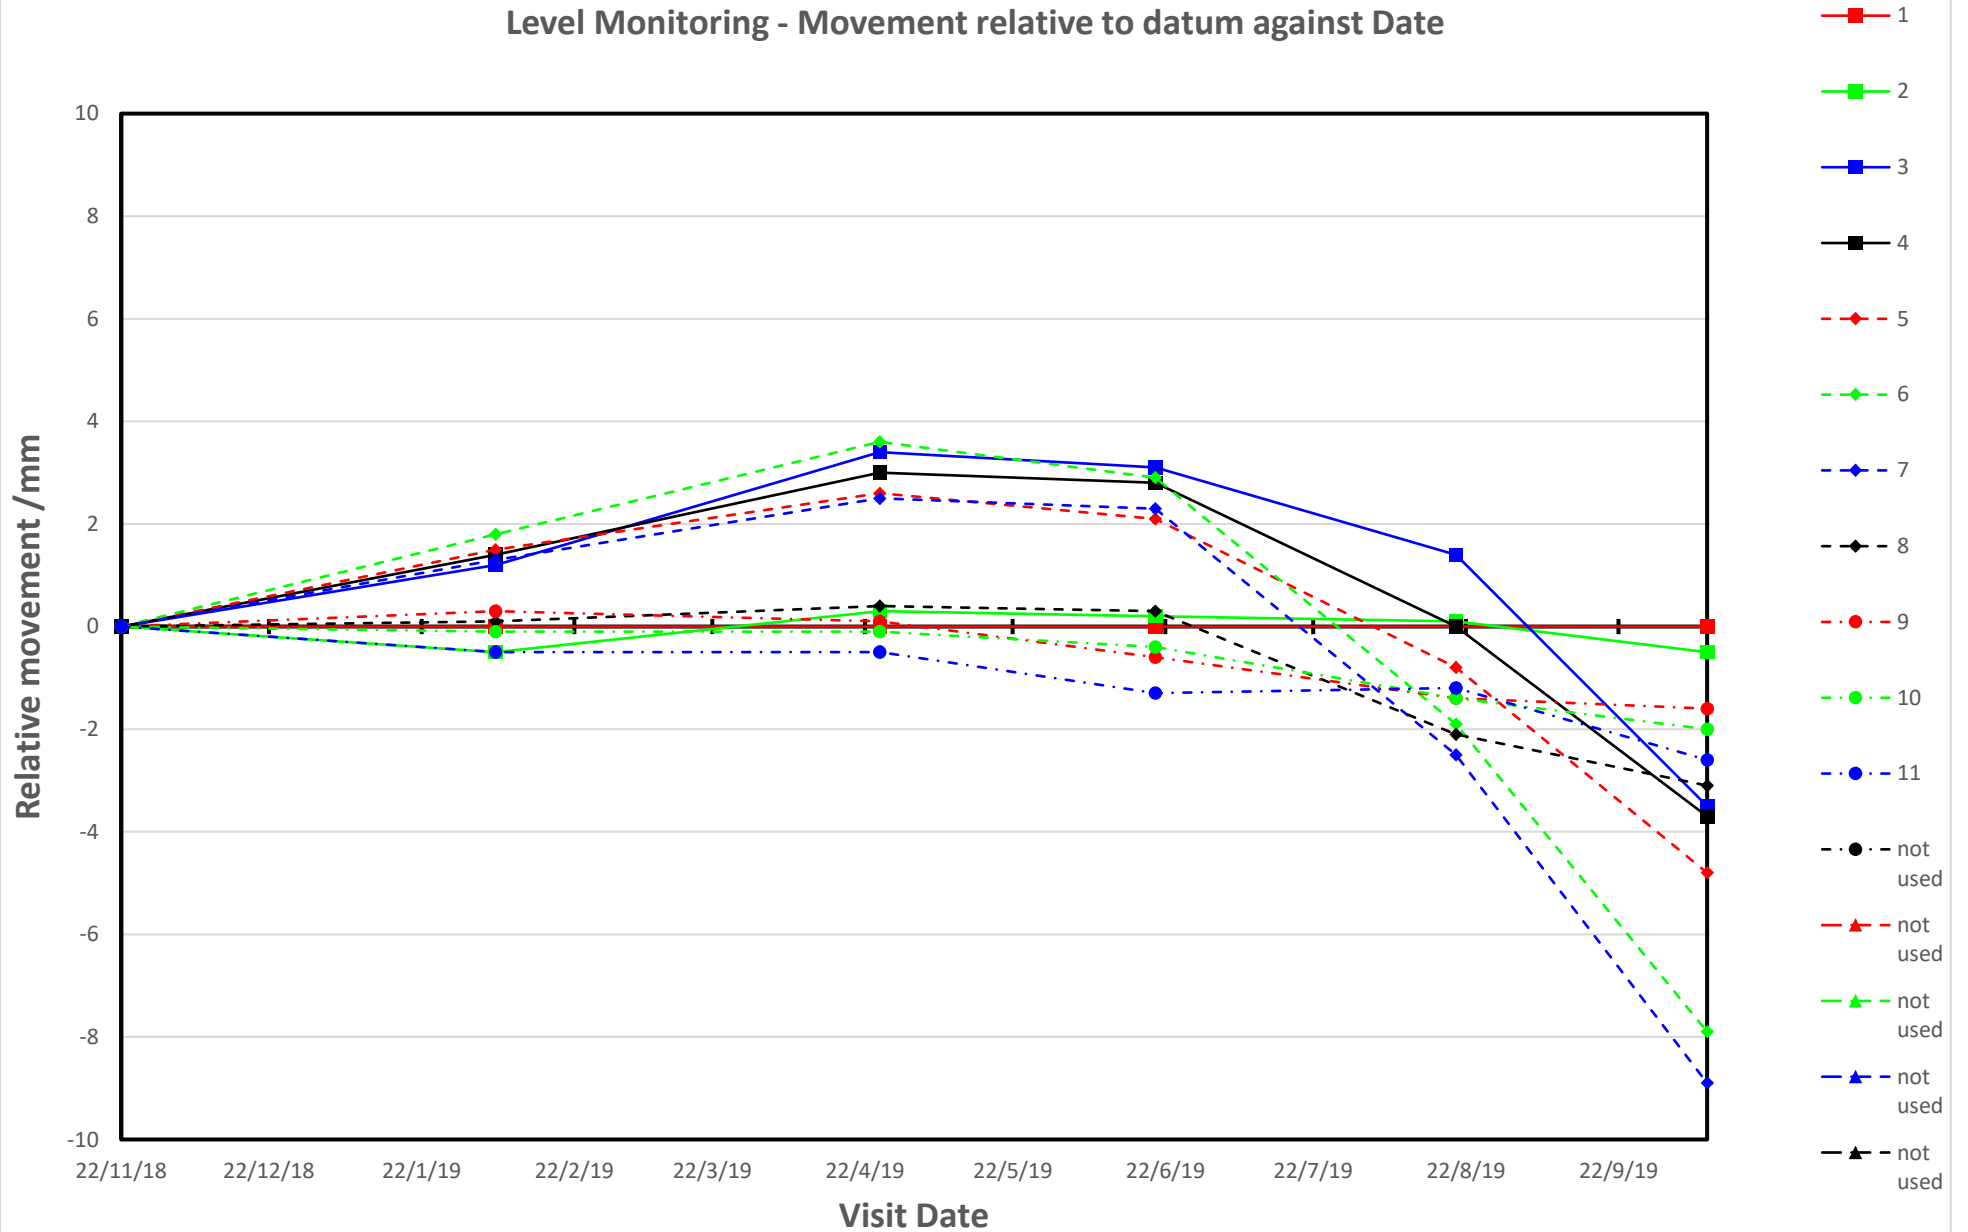



Our ref	Client ref	Client Name	Issue Date
552624	6873723	Sedgwick	10/10/2019

**Stud locations**

1	INT office LHS of window
2	INT laundry room
3	EXT above front garage
4	EXT LHS where house meets extension
5	EXT LHS low level DPS level
6	

**Additional instructions / notes**

**Crack Monitoring - Readings**

Studs nos.	Align-ment	Visit Date	22/11/18	Visit Date	06/02/19	Visit Date	25/04/19	Visit Date	20/06/19	Visit Date	20/08/19	Visit Date	10/10/19
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	51.83	0.29	51.80	0.27	51.69	0.25	51.54	0.24	51.64	0.33	51.94	0.64
1	D	71.91	0.88	71.90	0.85	71.68	0.77	71.65	0.75	71.88	0.75	72.24	0.83
1	Check	84.50		84.50		84.53		84.51		84.51		84.53	
2	H	62.29	0.97	62.02	0.75	61.85	0.66	61.82	0.64	61.96	1.05	62.20	1.17
2	D												
2	Check												
3	H												
3	D	52.50	1.28	52.37	1.19	52.31	1.17	52.12	1.16	51.68	0.82	53.67	1.58
3	Check												
4	H	82.37	2.50	82.29	2.38	82.02	2.25	81.95	2.21	82.52	2.60	84.05	4.01
4	D												
4	Check												
5	H												
5	D	54.09	3.40	53.97	3.29	53.79	3.20	53.65	3.14	54.26	3.87	56.13	4.14
5	Check												
6	H												
6	D												
6	Check												
Calliper nos :		7539		7539		7539		9616		9814		1370	
Technician :		AH		AH		AH		JH/JY		JL		RB	

Our ref	Client ref	Client Name	Issue Date
552624	6873723	Sedgwick	10/10/2019

### Crack Monitoring - Movement Against Time

