



**Report of Sound Insulation Testing
at
Fountain House
Welwyn Garden City
Hertfordshire**

Report No: DJB/6982/B
Date of Issue: 26 April 2017
Property Type: Dwellings to be formed by a material change of use

Date of Test: 13 April 2017

ACOUSTICAL INVESTIGATION & RESEARCH ORGANISATION LTD

Duxons Turn, Maylands Avenue, Hemel Hempstead, Herts, HP2 4SB Telephone: 01442 247146

AIRO is a UKAS accredited testing laboratory No. 0483 and measurements to British Standards BS EN ISO 140-4 & 7:1998 and BS EN ISO 717-1 & 2:1997 together with Approved Document E to The Building Regulations are included on our schedule of accreditation. UKAS is the United Kingdom Accreditation Service.

Test Engineer:

Client: GPL 2014 Ltd
9 Bridewell Pace
London
EC4V 6AW

D J Boaden

**D J Boaden BSc MInstP MIOA
Managing Consultant**

Comparison with Approved Document E (2003) to The Building Regulations 2010 (ref 1)

Test No.	Rooms	$D_{nT,w} + C_{tr}$ (dB)		
		Measured	Required	Pass/Fail
1	The Nail Parlour, Ground Floor to Main Office Space, 1 st Floor,	64	≥ 43	PASS

Equipment

Type	Serial No.	Type	Serial No.
Norsonic 140 Sound Analyzer	1403123	Norsonic 1209 Microphone Pre-Amplifier	12703
Norsonic 140 Sound Analyzer	1403164	Norsonic 1209 Microphone Pre-Amplifier	12554
GRAS 40AE ½" Condenser Microphone	97969	B&K 4231 Sound Level Calibrator	1795485
GRAS 40AE ½" Condenser Microphone	97972		

The test procedures in Annex B of Approved Document E (2003) have been followed except as follows:

Exception	Reason
B2.15 – Direction of test should be from larger to smaller room.	Direction selected to reflect proposed non-residential to residential use.

Approved by:

D L Watts

**Eur Ing D L Watts BEng CEng FIOA
Principal Consultant**

ACOUSTICAL INVESTIGATION & RESEARCH ORGANISATION LTD

**Duxons Turn
Maylands Avenue
Hemel Hempstead
Hertfordshire
HP2 4SB
Telephone: 01442 247146**



Report No: DJB/6982/B
Date of Issue: 26 April 2017
Property Type: Dwellings to be formed by a material change of use


Date of Test: 13 April 2017

Test 1 – Airborne Sound Insulation across Separating Floor

Test No.	SOURCE ROOM		RECEIVE ROOM	
	Room	Vol. (m ³)	Room.	Vol. (m ³)
1	The Nail Parlour, Ground Floor	73	Main Office Space, 1 st Floor	> 100

Standardized Level Difference according to BS EN ISO 140-4:1998

Frequency (Hz)	D_{nT} (dB)
50	
63	
80	
100	≥ 50.6
125	≥ 51.6
160	55.9
200	56.9
250	59.3
315	67.8
400	71.2
500	≥ 71.0
630	≥ 69.4
800	≥ 67.5
1000	≥ 64.6
1250	≥ 70.0
1600	≥ 74.5
2000	≥ 75.5
2500	≥ 79.7
3150	≥ 81.0
4000	≥ 79.5
5000	≥ 77.6
6300	
8000	
10000	

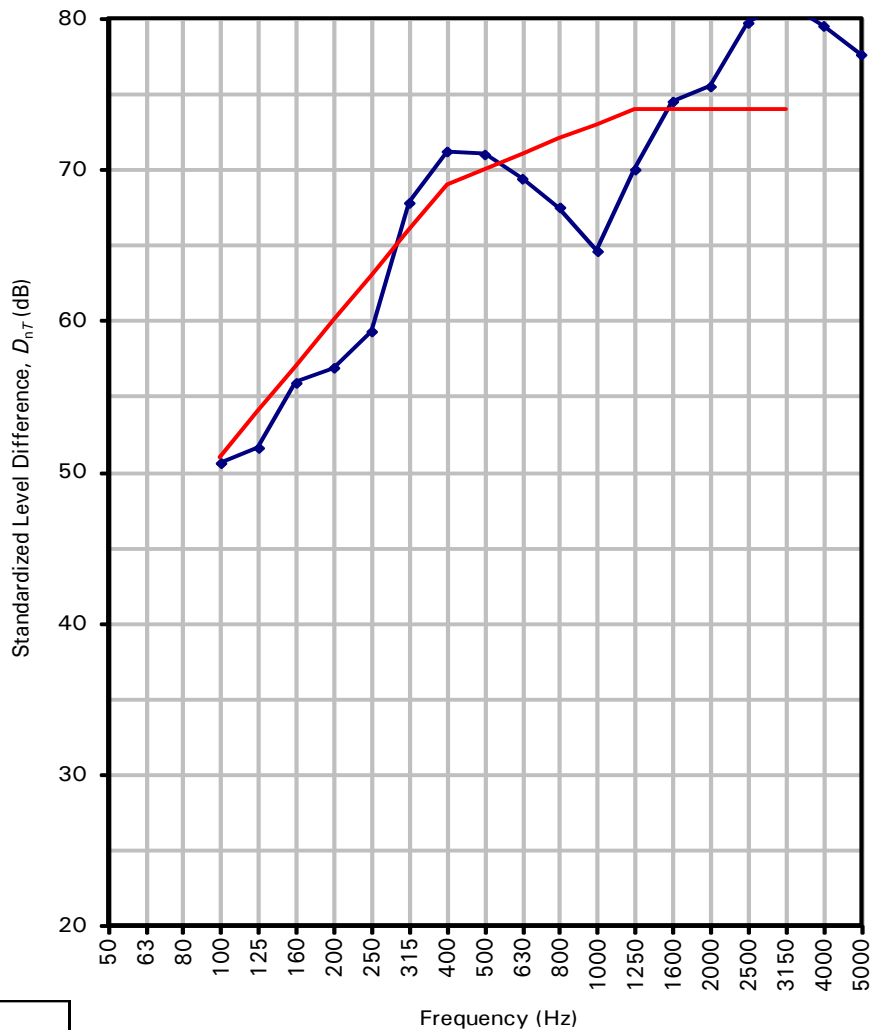

Rating according to BS EN ISO 717-1:1997	
$D_{nT,w} (C; C_{tr}) =$	70 (-2;-6) dB
$D_{nT,w} + C_{tr} =$	64 dB

—◆— Measured Standardized Level Difference, D_{nT} (dB)
— Reference curve (BS EN ISO 717-1:1997)

$C_{50-3150}$: -- $C_{50-5000}$: -- $C_{100-5000}$: -1 dB
 $C_{tr,50-3150}$: -- $C_{tr,50-5000}$: -- $C_{tr,100-5000}$: -6 dB

Evaluation based on a result obtained by a field method

Report No: DJB/6982/B
Date of Issue: 26 April 2017
Property Type: Dwellings to be formed by a
material change of use

Date of Test: 13 April 2017

Procedure

Airborne Sound Insulation to BS EN ISO 140-4:1998

Airborne sound insulation measurements were performed according to a prescribed procedure that specifies that the sound generated in the source room shall be steady and have a continuous spectrum in the frequency bands of interest. Measurements of the sound levels were made in both source and receive rooms at the one-third octave intervals from 100 Hz to 5000 Hz as recommended in the Standard (ref 2). The measurements were made such as to obtain a spatial average of the sound pressure level in each room. Reverberation time measurements were made in the receive room following the procedures of British Standard BS EN 20354:1993 (ref 3).

The Standardized Level Difference (D_{nT}) in decibels (dB) is calculated in each frequency band using the equation:

$$D_{nT} = L_1 - L_2 + 10 \lg \frac{T}{T_0} \quad \text{dB}$$

where

- D_{nT} is the Standardized Level Difference (dB)
- L_1 is the average sound pressure level in the source room (dB)
- L_2 is the average sound pressure level in the receive room (dB)
- T is the average reverberation time of the receive room (seconds)
- T_0 is the reference reverberation time of 0.5 seconds

The Weighted Standardized Level Difference ($D_{nT,w}$) in decibels (dB) and the Spectrum Adaptation Terms (C and C_{tr}), also in decibels, are calculated in accordance with BS EN ISO 717-1:1997 (ref 4) by comparison of the sixteen values of Standardized Level Difference from 100 Hz to 3150 Hz with the relevant reference curves.

Report No: DJB/6982/B
Date of Issue: 26 April 2017
Property Type: Dwellings to be formed by a
material change of use

Date of Test: 13 April 2017

References

1. The Building Regulations 2010

Approved Document E: Resistance to the passage of sound (2003 Edition incorporating 2004, 2010, 2013 and 2015 amendments)

- E1 Protection against sound from other parts of the building and adjoining buildings
- E2 Protection against sound within a dwelling-house etc
- E3 Reverberation in the common internal parts of buildings containing flats or rooms for residential purposes
- E4 Acoustic conditions in schools

2. British Standard BS EN ISO 140

Acoustics - Measurements of sound insulation in buildings and of building elements

BS EN ISO 140-4:1998

Field measurements of airborne sound insulation between rooms

3. British Standard BS EN 20354:1993

Acoustics - Measurement of sound absorption in a reverberation room

4. British Standard BS EN ISO 717

Acoustics - Rating of sound insulation in buildings and of building elements

BS EN ISO 717-1:1997

Airborne sound insulation